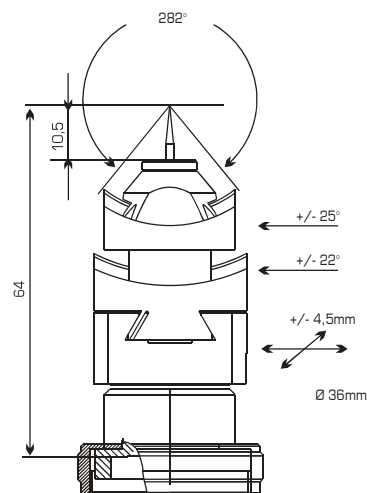



Goniometer head 1001

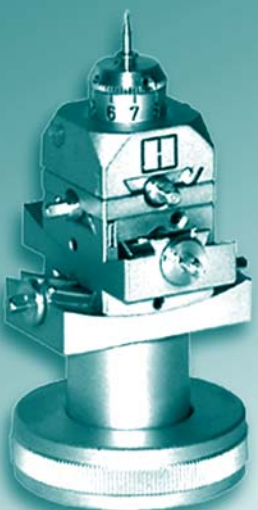
Adjustable axes:	X, Y Ry, Rx
Range X, Y [mm]:	$\pm 4,5$
Range Ry [°]:	± 22
Range Rx [°]:	± 25
Height [mm]:	64
Read-out accuracy [°]:	0,1
Weight [kg]:	0,2


Accessories

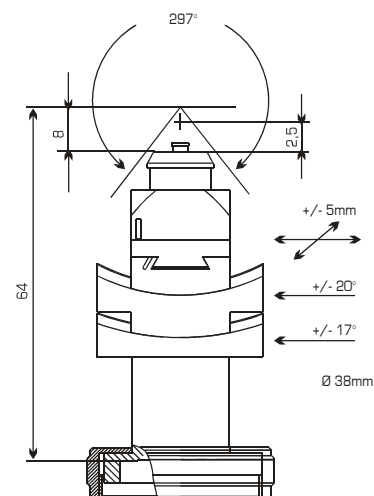
Supports:	1055
	1412
	1413

Included:

- storage container
- adjustment pin
- spanner
- adhesive wax


Goniometer head 1002

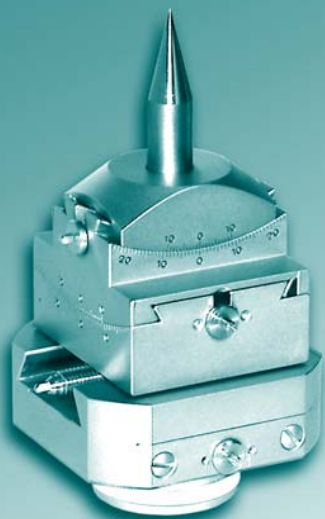
Adjustable axes:	Rx, Ry Y, X, Z
Range X, Y [mm]:	± 5
Range Z [mm]:	$\pm 1,25$
Range Ry [°]:	± 20
Range Rx [°]:	± 17
Height [mm]:	64
Read-out accuracy [°]:	0,1
Weight [kg]:	0,16


Accessories

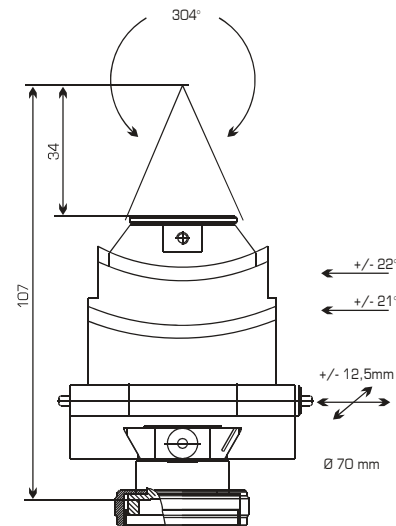
Supports:	1055
	1412
	1413

Included:

- storage container
- adjustment pin
- spanner
- adhesive wax


Goniometer head 1003

Adjustable axes:	X, Y Ry, Rx
Range X, Y [mm]:	$\pm 12,5$
Range Ry [°]:	± 21
Range Rx [°]:	± 22
Height [mm]:	107
Read-out accuracy [°]:	0,1
Weight [kg]:	1,0


Accessories

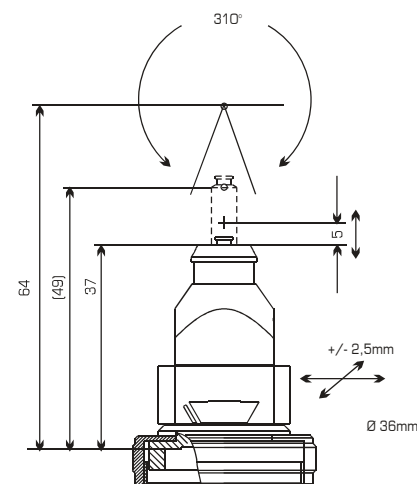
Supports:	1055
	1412
	1413

Included:

- storage container
- adjustment pin
- spanner
- adhesive wax


Goniometer head 1004

Adjustable axes:	Y, X, Z
Range X, Y [mm]:	$\pm 2,5$
Range Z [mm]:	$\pm 2,5$
Height [mm]:	49/64
Weight [kg]:	0,12


Accessories

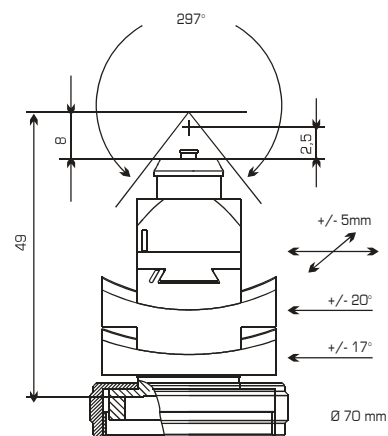
Supports:	1055
	1412
	1413

Included:

- storage container
- adjustment pin
- spanner
- adhesive wax
- extension 49/64


Goniometer head 1005

Adjustable axes:	X, Y, Z Rx, Ry
Range X, Y [mm]:	±5
Range Z [mm]:	2,5
Range Ry [°]:	±20
Range Rx [°]:	±17
Height [mm]:	49
Read-out accuracy [°]:	0,1
Weight [kg]:	0,14


Accessories

Supports:	1055 1412 1413
-----------	----------------------

Included:

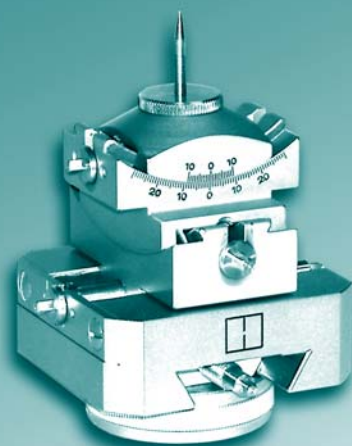
- storage container
- adjustment pin
- spanner
- adhesive wax

Accessories

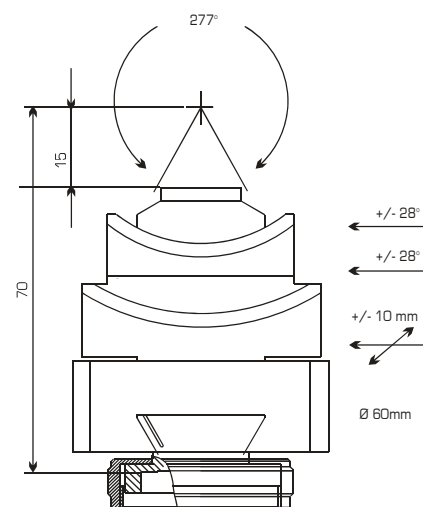
Supports:	1055 1412 1413
-----------	----------------------

Included:

- storage container
- adjustment pin
- spanner
- adhesive wax

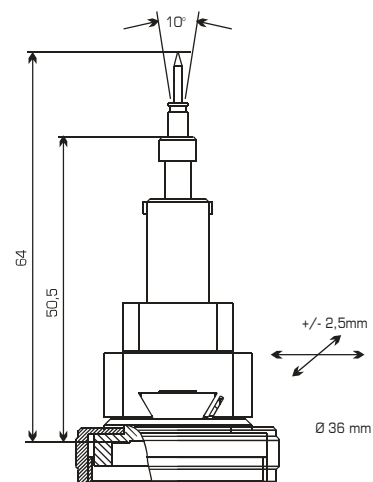

Goniometer head 1006

Adjustable axes:	Ry, Rx X, Y
Range X, Y [mm]:	±10
Range Rx, Ry [°]:	±28
Height [mm]:	70
Read-out accuracy [°]:	0,1
Weight [kg]:	0,5




Goniometer head 1007

Adjustable axes:	X, Y Tilt
Range X, Y [mm]:	$\pm 2,5$
Tilt [°]:	± 10
Height [mm]:	64
Weight [kg]:	0,11


Accessories

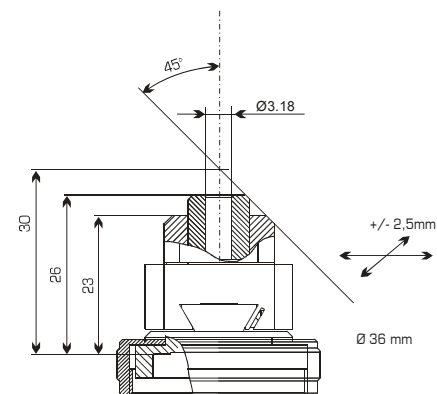
Supports:	1055 1412 1413
-----------	----------------------

Included:

- storage container
- adjustment pin
- spanner
- adhesive wax


Goniometerkopf 1007-S

Adjustable axes:	X, Y
Range X, Y [mm]:	$\pm 2,5$
Height [mm]:	26
Weight [kg]:	0,10


Accessories

Supports:	1055 1412 1413
-----------	----------------------

Included:

- storage container
- adjustment pin
- spanner
- adhesive wax